



3M™ Speedglas™ Welding Helmet 9002NC

To optimize the effective lifespan of your welding equipment and avoid the additional cost of replacement, regular maintenance is important. Replace all damaged parts immediately to help ensure intended degree of protection.


Before use

- ① **Helmet and headband:** inspect for cracks or any damaged parts. Replace if needed.
- ② **Sweatband:** ensure it is in good condition and clean.
- ③ **Protection plates:** to help provide the best possible vision, they should be clean and without scratches. Replace if needed.
- ④ **Welding filter:** ensure that the low-battery indicator is not flashing and check that the sensors are clean and uncovered.
- ⑤ **Headcover:** verify it's in place and free from splits and tears.


After use

- ① **Clean the helmet:** wipe with a moist tissue or cloth, both inside and outside the helmet. **Do not** rinse, immerse in water, or clean with solvents.
- ② **Protection plates and visor plate:** clean with a soft cloth and replace if any pits or scratches occur.
- ③ **Storage:** store the helmet in a dry, clean area away from direct sunlight, high temperatures and solvents.

Accessories and consumables

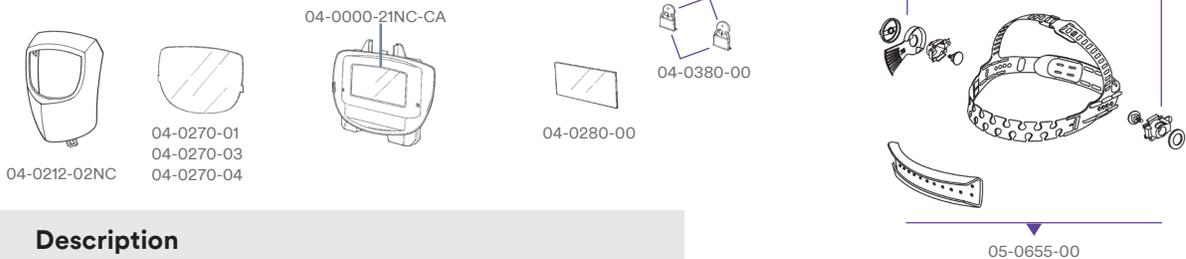

| Part No | Description |
|-----------------|--|
| 04-0100-20NC-CA | 3M™ Speedglas™ Welding Helmet 9002NC (does not include the headcover or additional coverage) |
| 04-0112-00NC | 3M™ Speedglas™ Welding Helmet 9000 without ADF welding filter |
| 04-0000-21NC-CA | 3M™ Speedglas™ Welding Filter |
| 04-0212-02NC | 3M™ Speedglas™ Front Panel |
| 04-0270-01 | Outside protection plate, 10/case |
| 04-0270-03 | Outside protection plate, scratch resistant, 10/case |
| 04-0270-04 | Outside protection plate, high temperature, 10/case |
| 04-0280-00 | Inside protection plate, 5/case |
| 04-0320-00 | Battery, 2/case |
| 04-0380-00 | Battery holders blue, 2/case |
| 05-0655-00 | Comfort Headband with Assembly Parts |
| 05-0660-00 | Assembly parts for headband |
| 06-0700-83 | Full hood black/grey |
| 06-0500-56 | Magnification plate 15x |
| 06-0500-57 | Magnification plate 20x |
| 06-0500-58 | Magnification plate 25x |
| 06-0500-59 | Magnification plate 30x |
| 07-0014-00NR | Hard Hat Adaptor |
| 18-0099-68 | Throat and side protector, leather |

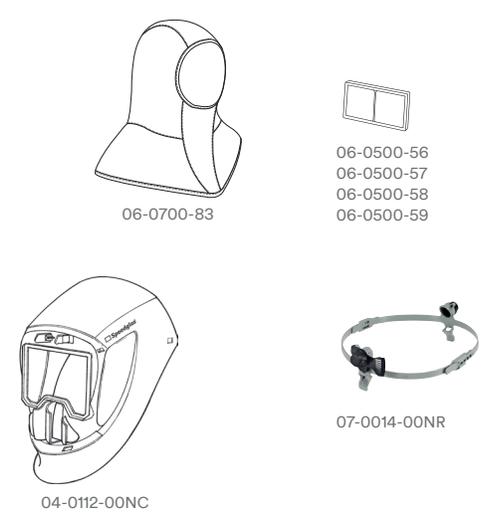

Warning: Respirators help protect against certain airborne contaminants. Before use, the wearer must read and understand the User Instructions provided as a part of the product packaging. Follow all local regulations. A written respiratory protection program must be implemented meeting all the requirements of OSHA 1910.134 including training, fit testing and medical evaluation. In Canada, CSA standard Z94.4 requirements must be met and/or requirements of the applicable jurisdiction, as appropriate. Misuse may result in sickness or death. For correct use, consult your supervisor and User Instructions, or call 3M Personal Safety Division (PSD) Technical Service in Canada 1-800-267-4414.

Personal Safety Division
3M Canada
P.O. Box 5757
London, ON N6A 4T1
1-800-267-4414
3m.ca/Welding